



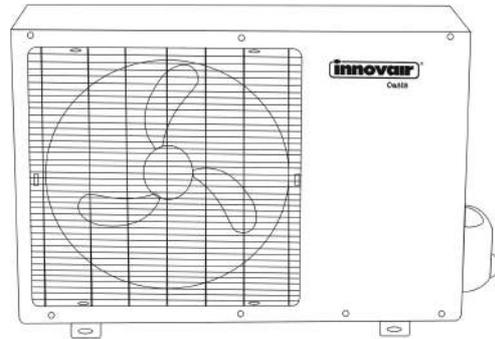

Oasis

TROUBLESHOOTING GUIDE

W0E36C2DB1 / H0E36C2MR1

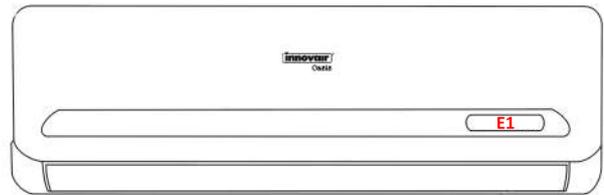

MINI SPLIT SYSTEM

9. Troubleshooting

9.1 Indoor unit error display

Operation lamp	Auto lamp	Timer lamp	Failure
☆	☆	☆	Over current protection occurs 4 times
☆	X	☆	EEPROM error
X	X	☆	The T1 sensor is open circuit or short circuit
☆	X	X	The T2 sensor is open circuit or short circuit
X	☆	X	Indoor / outdoor units communication error


O (light)

X (off)


☆ (flash)

9.2 Diagnosis and Solution


9.2.1 Over current protection occurs 4 times diagnosis and solution

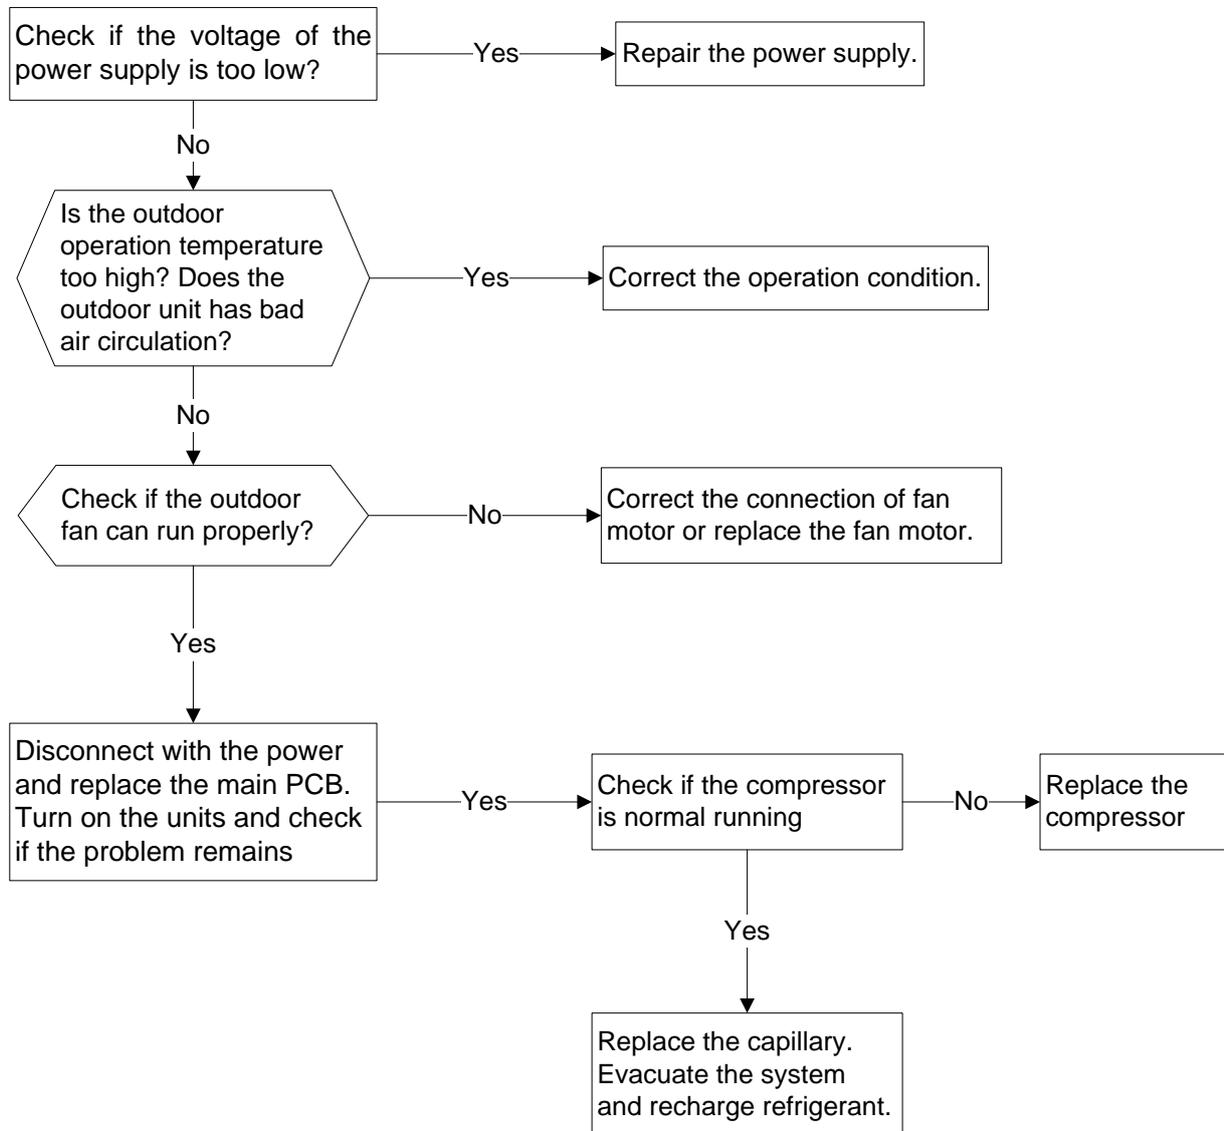

9.2.2 The temp sensor is open circuit or short circuit diagnosis and solution

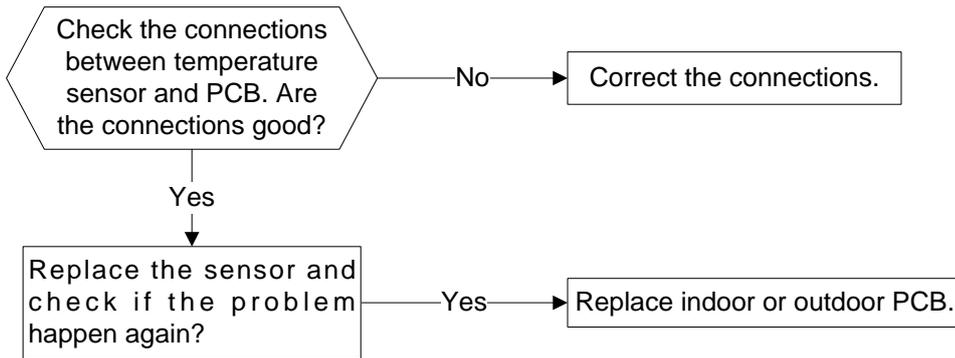

9.2.3 EEPROM parameter error diagnosis and solution

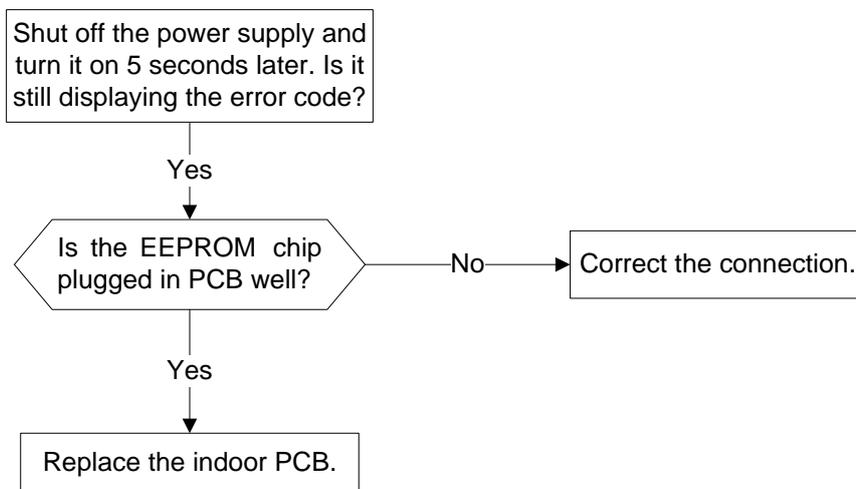

9.2.4 Communication malfunction between indoor unit and outdoor unit diagnosis and solution

